

Date: 3/May/2016

Overall Information

Table1- Overall Information

745761	L- Overall Injormation
Vehicle plate number	33572 (28958)
CPK data logger number	LN: 001521, DN: 1995, Sim Number +989218469643
Bus line	Number 2 (west to east bus line)
Bus Terminals	Khavaran Bus Terminal - Western Bus Terminal
Total path distance	19 km
DPF producer company	HJS_03 (active system with FBC – electrical heater)
Installation date	19/Feb/2015
Report period	16/Apr/2016 – 30/Apr/2016 (fifteen days)
K value - DPF upstream	1.95 [1/m]
K value – DPF downstream	0.02 [1/m]

Table 2- DPF Maintenance History

rable 2 Bit Walletiance History		
Filter maintenance date	DPF was cleaned on Oct 5 th for the first time. The second cleaning was done on Dec 19 th . The third cleaning was done on Apr 2 nd after 55613 km.	
Dosing status	Dosing value has been kept constant from installation date until now.	



Date: 3/May/2016

Table 3- Fuel and Additive Consumption Information

Table 3 Taer and Taarer	e Consumption injornation
Bus mileage (from DPF installation date)	60132 km
Bus mileage over the period	2180 km
Working days over the period	13 days
Stop days	2 days
Data logger working days	13 days
Working hours over the period	167 hours 42 minutes
Average working hours per day (including stop days)	11 hours 58 minutes
Bus average speed	13 km/hr
idle speed time to all working time ration	53.68 %
Total Bus fuel consumption over the period	1482 lit
Fuel consumption per hour	8.8 lit/hr
Average fuel consumption	0.68 lit/km
Total Bus additive consumption over the period	0.7 lit
Average additive consumption	325 cc/km
Additive consumption to fuel ration	479 cc/1000lit



Date: 3/May/2016

Temperature, Pressure and Engine Speed Overview

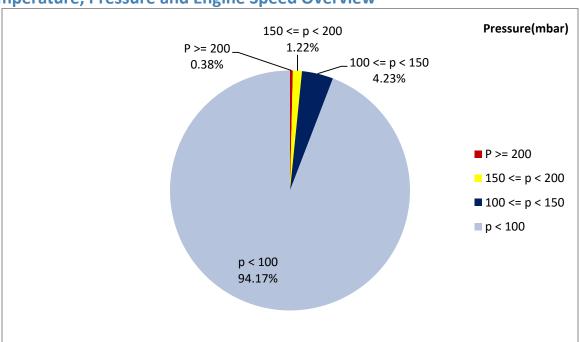


Figure 1- Pressure distribution over the working hours

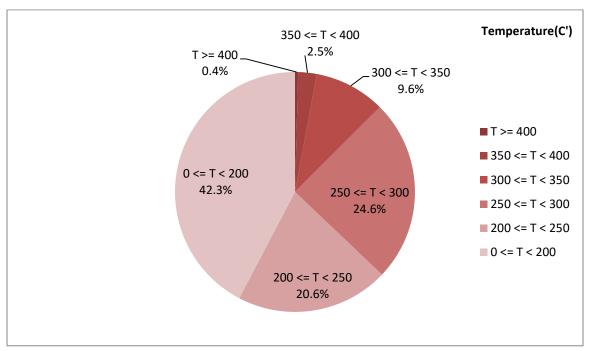


Figure 2-Temperature distribution over the working hours



Date: 3/May/2016

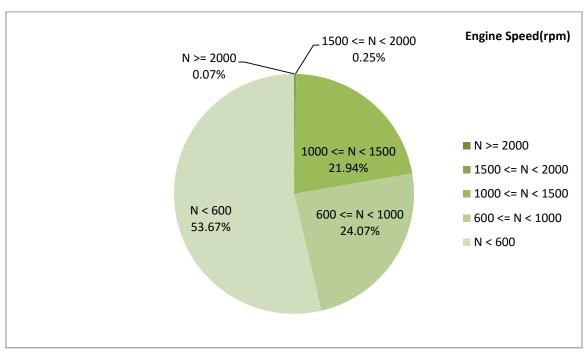


Figure 3- Engine speed distribution over the working hours

Table 4- Mean values

Mean temperature (C)	Mean pressure(mbar)	Mean engine speed(rpm)
219.28	31.76	740

Table 5- Mean values without idling

Mean temperature (C)	Mean pressure(mbar)	Mean engine speed(rpm)
272.26	60.28	965

Table 6- Max-min values

Max-min temperature(C)	Max-min pressure(mbar)	Max-min engine speed(rpm)
462-50	426-0	2160-544



Date: 3/May/2016

Detailed Pressure Analysis

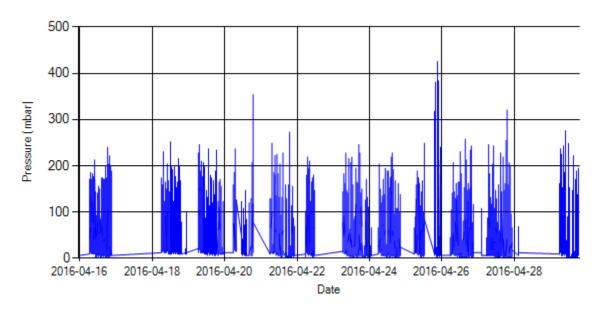


Figure 4- Pressure distribution over the period

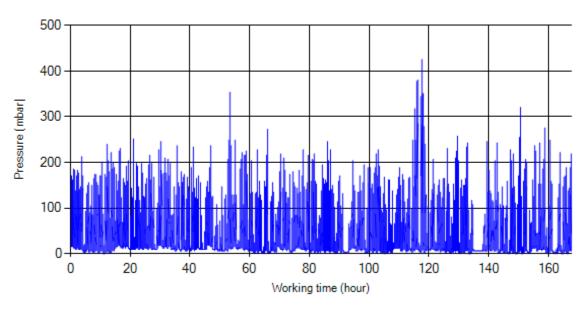


Figure 5- Pressure vs. working hours

Notice: backpressure distribution was shown into two diagrams. As obvious in figure 5, stopworking periods were eliminated and pressure was displayed along working hours.



Date: 3/May/2016

Detailed Temperature Analysis

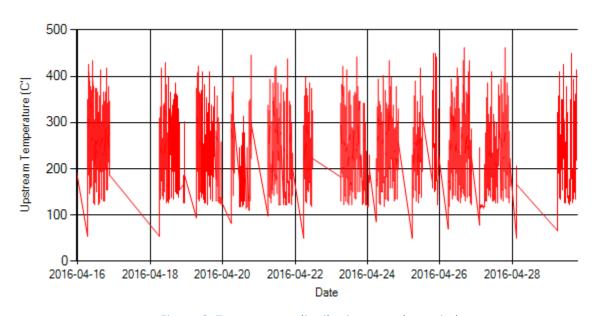


Figure 6- Temperature distribution over the period

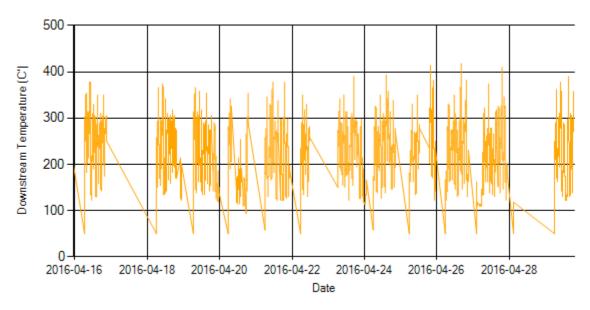


Figure 7- Temperature distribution over the period



Date: 3/May/2016

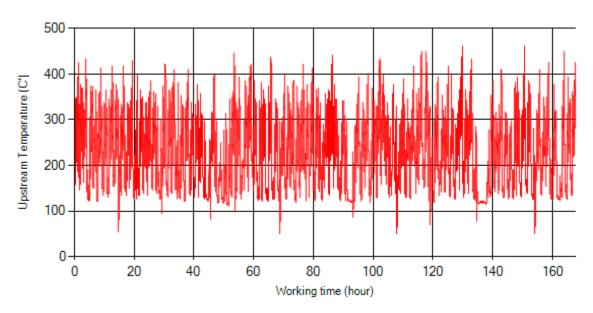


Figure 8- Temperature vs. working hours

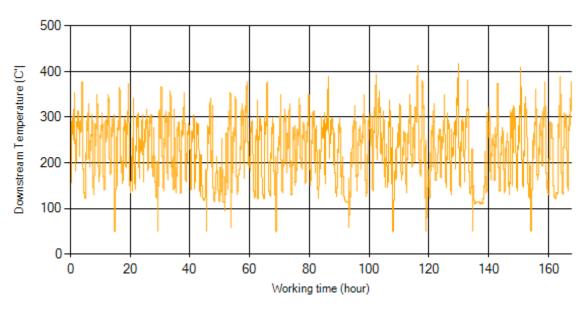


Figure 9- Temperature vs. working hours



Date: 3/May/2016

Engine Speed Diagrams

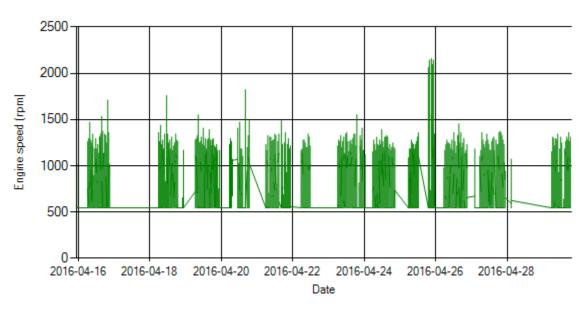


Figure 10- Engine speed distribution over the period

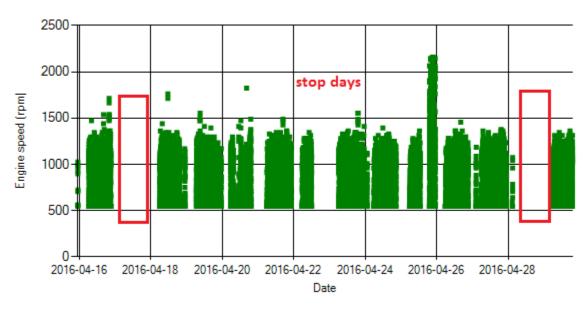


Figure 11- Engine speed diagram for calculating CPK's working days



Date: 3/May/2016

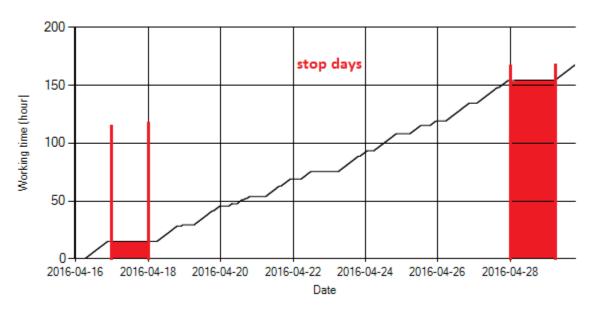


Figure 12- Time diagram for calculating CPK's working days

Notice: Data logger sampling time can be calculated from Figure 12. The lines parallel with Date axis show days without data logger data. As depicted in Figure 12 vehicle didn't work for 2 days.

Pressure-Engine Speed diagrams



Figure 13- Pressure against engine speed



Date: 3/May/2016

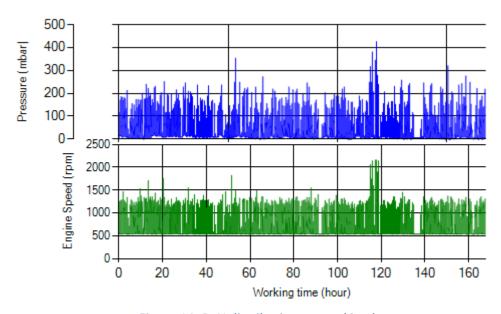


Figure 14- P, N distribution vs. working hours

Temperature-Engine Speed diagrams

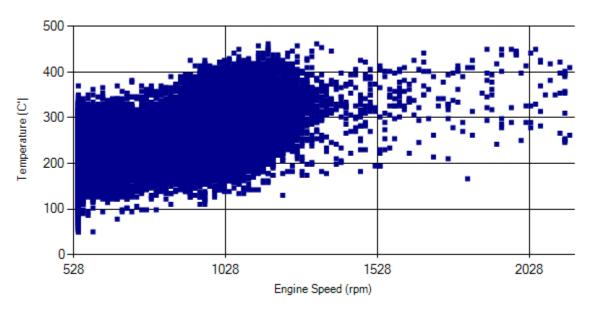


Figure 15- Temperature against engine speed



Date: 3/May/2016

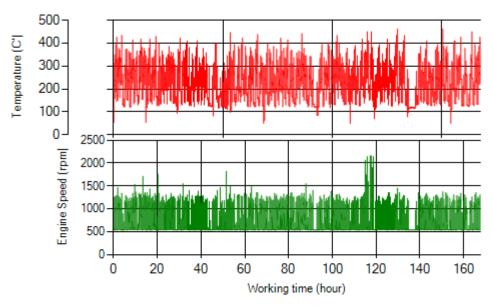


Figure 16- T, N distribution vs. working hours

Filter Operation Analysis

- As depicted in figure 1, 0.38% of total working time pressure is above 200 mbar and 1.66% above 150 mbar during this period.
- Figure 2 displays flow temperature distribution for DPF's upstream. It can be obviously observed 2.9 % of total working time temperature is above 350°C.

Filter energtion status	Excellent	Good ■
Filter operation status	Maintenance required □	Failed \square