

Date: 18/Jul/2016

# Notice: System was working over this period without DPF.

### **Overall Information**

#### Table1- Overall Information

	,	
Vehicle plate number	33637 (34119)	
CPK data logger number	LN: 001492, DN: 1933, Sim +989210000000	
Bus line	Number 2 (west to east bus line)	
Bus Terminals	Khavaran Bus Terminal - Western Bus Terminal	
Total path distance	19 km	
DPF company producer	Dinex_02 (Passive system with FBC)	
Installation date	02/Jun/2015	
Report period	01/Jul/2016 – 15/Jul/2016 (fifteen days)	
K value - DPF upstream	- [1/m]	
K value – DPF downstream	- [1/m]	

#### Table 2- DPF Maintenance History

Table 2 Bit Walletiance History		
Filter maintenance date	DPF has been removed after two weeks working on Jun 17 <sup>th</sup> . After receiving cleaning machine DPF was cleaned on Aug 10 <sup>th</sup> and was installed on Aug 22 <sup>nd</sup> but worked only for ten days. The last cleaning was done on Sep 24 <sup>th</sup> but cleaning issue was unavoidable after only three days working. Finally DPF was replaced by muffler on Sep 8 <sup>th</sup> and system have been working from that date without DPF.	
Dosing status	Additive dosing was increased 60% of its initial value for tests two and three.	



Date: 18/Jul/2016

Table 3- Fuel and Additive Consumption Information

	T T T T T T T T T T T T T T T T T T T
Bus mileage over the period	3536 km
Working days over the period	15 days
Stop days	0 day
Data logger working days	15 days
Working hours over the period	208 hours 7 minutes
Average working hours per day (including stop days)	13 hours 52 minutes
Bus average speed	17 km/hr
idle speed time to all working time ration	21.53 %
Total Bus fuel consumption over the period	1662 lit
Fuel consumption per hour	7.99 lit/hr
Average fuel consumption	0.47 lit/km



Date: 18/Jul/2016

#### **Temperature, Pressure and Engine Speed Overview**

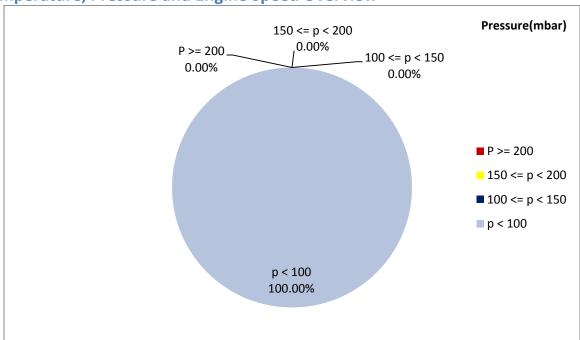


Figure 1- Pressure distribution over the working hours

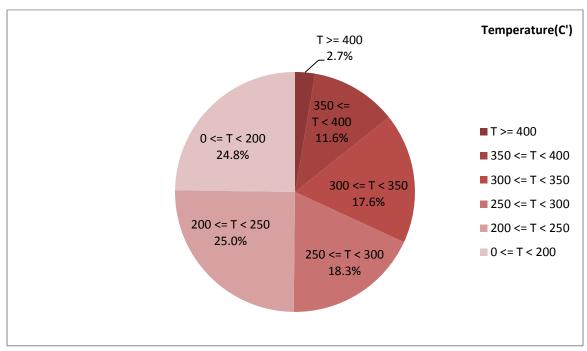


Figure 2-Temperature distribution over the working hours



Date: 18/Jul/2016

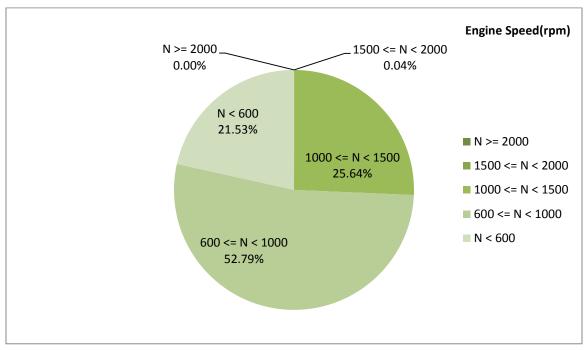


Figure 3- Engine speed distribution over the working hours

#### Table 4- Mean values

Mean temperature (C)	Mean pressure(mbar)	Mean engine speed(rpm)
257.96	1.37	835

Table 5- Mean values without idling

Mean temperature (C)	Mean pressure(mbar)	Mean engine speed(rpm)
274.44	1.75	914

#### Table 6- Max-min values

Max-min temperature(C)	Max-min pressure(mbar)	Max-min engine speed(rpm)
518-50	66-0	1792-256



Date: 18/Jul/2016

#### **Detailed Pressure Analysis**

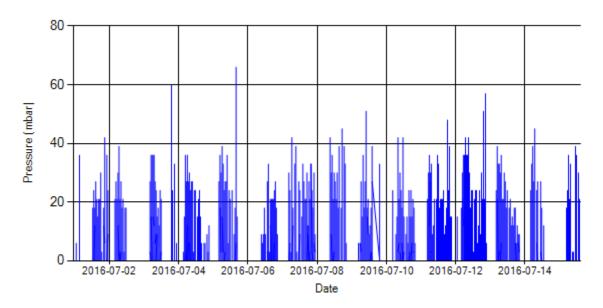


Figure 4- Pressure distribution over the period

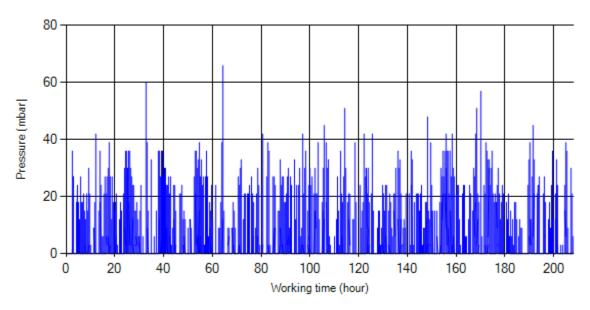


Figure 5- Pressure vs. working hours

Notice: backpressure distribution was shown into two diagrams. As obvious in figure 5, stopworking periods were eliminated and pressure was displayed along working hours.



Date: 18/Jul/2016

### **Detailed Temperature Analysis**

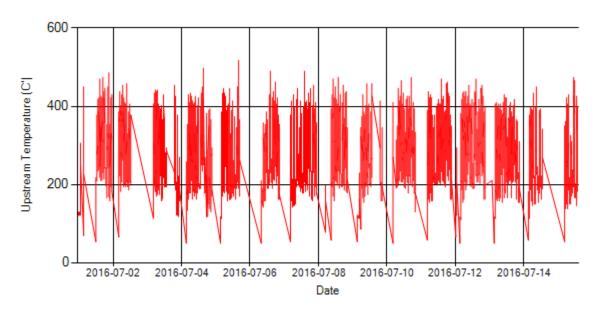


Figure 6- Temperature distribution over the period

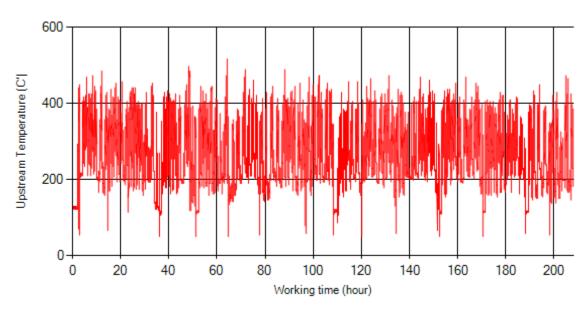


Figure 7- Temperature vs. working hours



Date: 18/Jul/2016

#### **Engine Speed Diagrams**

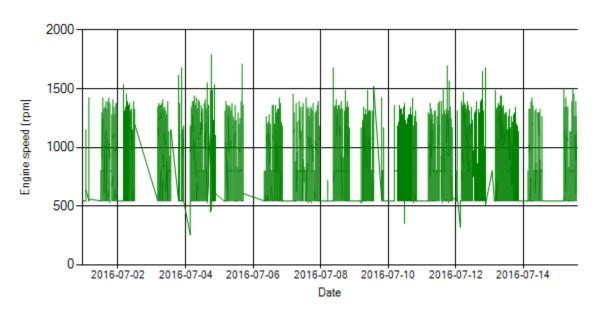


Figure 8- Engine speed distribution over the period

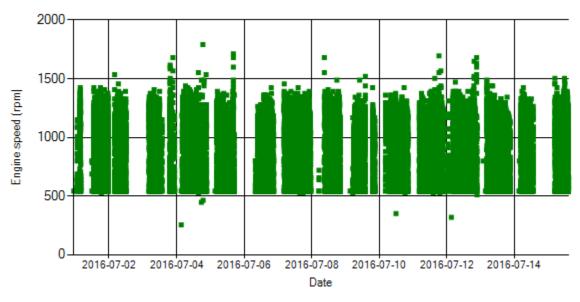


Figure 9- Engine speed diagram for calculating CPK's working days



Date: 18/Jul/2016

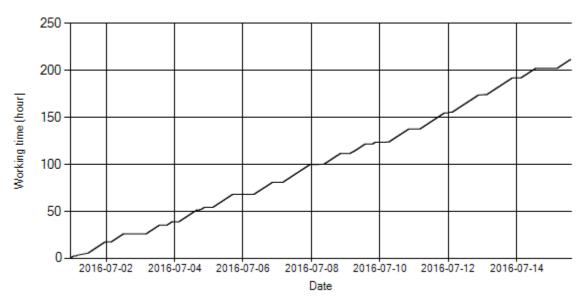


Figure 10- Time diagram for calculating CPK's working days

Notice: Data logger sampling time can be calculated from Figure 10. The lines parallel with Date axis show days without data logger data. As depicted in Figure 10 system was working all days.

### **Pressure-Engine Speed diagrams**

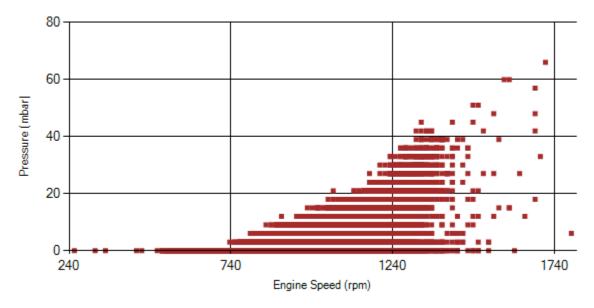


Figure 11- Pressure against engine speed



Date: 18/Jul/2016

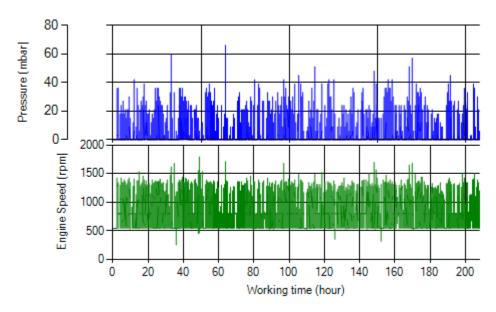


Figure 12- P, N distribution vs. working hours

### **Temperature-Engine Speed diagrams**

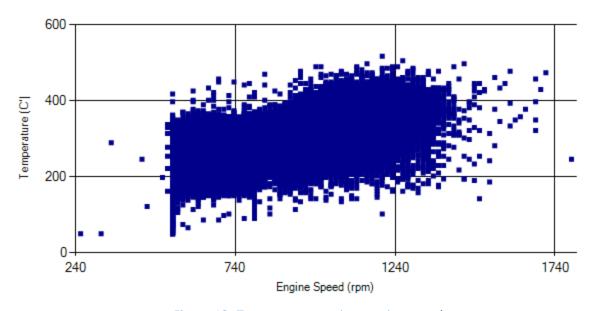


Figure 13- Temperature against engine speed



Date: 18/Jul/2016

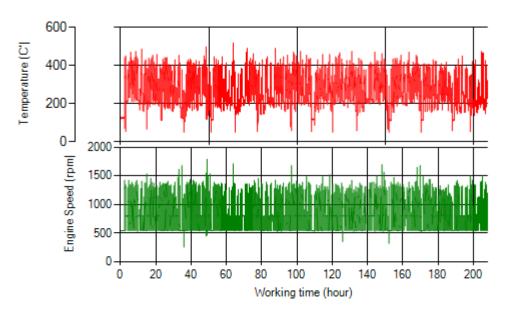


Figure 14- T, N distribution vs. working hours

## **Filter Operation Analysis**

**Notice:** System was working without DPF over the period.