

Date: 20/Sep/2015

Overall Information

Table1- Overall Information

rubici Overun injornation		
Vehicle plate number	85476	
CPK data logger number	LN: 001508, DN: 2003, Sim +989218469624	
Bus line	Number 10 (south to north Bus line)	
Bus Terminals	Azadi square - Daneshgah square	
Total path distance	10.7 km	
DPF producer company	HJS_04 (Passive system with FBC)	
Installation date	23/Feb/2015	
Report period	16/Aug/2015 – 31/Aug/2015 (sixteen days)	
K value - DPF upstream	1.95 [1/m]	
K value – DPF downstream	0.04 [1/m]	

Table 2- DPF Maintenance History

Filter maintenance date	DPF was cleaned on 22 nd Jul.	
Dosing status	Dosing value has been kept constant from installation date until now.	



Date: 20/Sep/2015

Table 3- Fuel and Additive Consumption Information

Tuble 3- Tuel ullu Adultive C	in the state of th
Bus mileage (from DPF installation date)	29132 km
Bus mileage over the period	2969 km
Working days over the period	15 days
Stop days	1 day
Data logger working days	15 days
Working hours over the period	222 hours 23 minutes
Average working hours per day (including stop days)	13 hours 54 minutes
Bus average speed	13.35 km/hr
idle speed time to all working time ration	58.03 %
Total Bus fuel consumption over the period	1905 lit
Fuel consumption per hour	8.57 lit/hr
Average fuel consumption	0.64 lit/km
Total Bus additive consumption over the period	0.800 lit
Average additive consumption	269 cc/km
Additive consumption to fuel ration	420 cc per 1000 lit (batch dosing with tank level)



Date: 20/Sep/2015

Temperature, Pressure and Engine Speed Overview

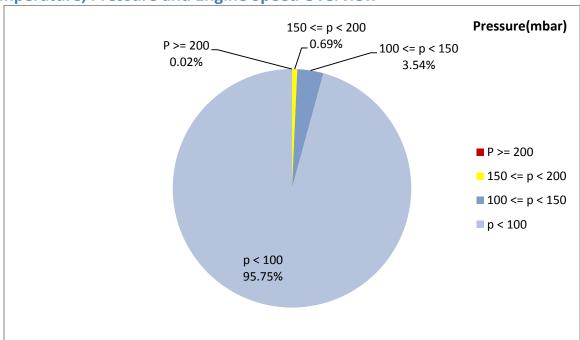


Figure 1- Pressure distribution over the working hours

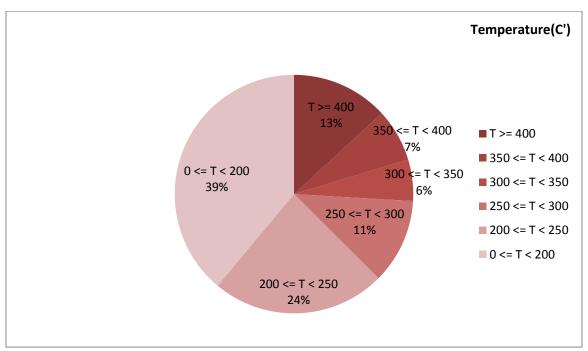


Figure 2-Temperature distribution over the working hours



Date: 20/Sep/2015

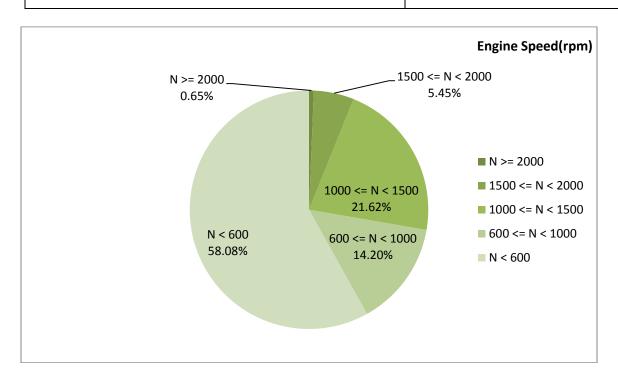


Figure 3- Engine speed distribution over the working hours

Table 4- Mean values

Mean temperature (C)	Mean pressure(mbar)	Mean engine speed(rpm)
248.9	23.29	816

Table 5- Mean values without idling

Mean temperature (C)	Mean pressure(mbar)	Mean engine speed(rpm)
	, , ,	
304.28	43.69	1148

Table 6- Max-min values

Max-min temperature(C)	Max-min pressure(mbar)	Max-min engine speed(rpm)
550-50	216-0	2544-256



Date: 20/Sep/2015

Detailed Pressure Analysis

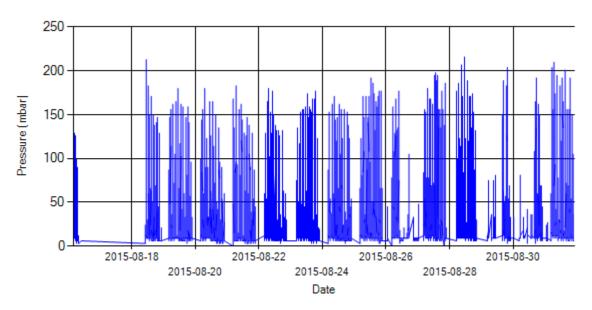


Figure 4- Pressure distribution over the period

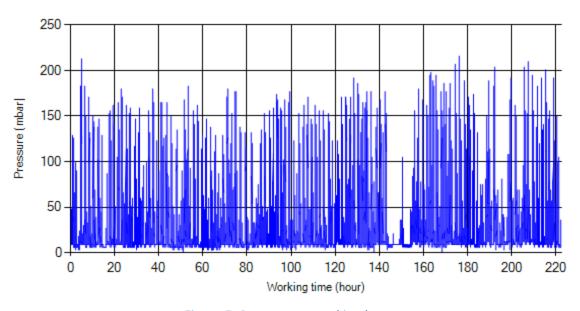


Figure 5- Pressure vs. working hours

Notice: backpressure distribution was shown into two diagrams. As obvious in figure 5, stopworking periods were eliminated and pressure was displayed along working hours.



Date: 20/Sep/2015

Detailed Temperature Analysis

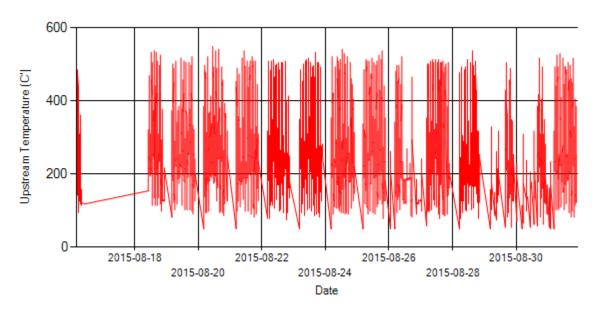


Figure 6- Temperature distribution over the period

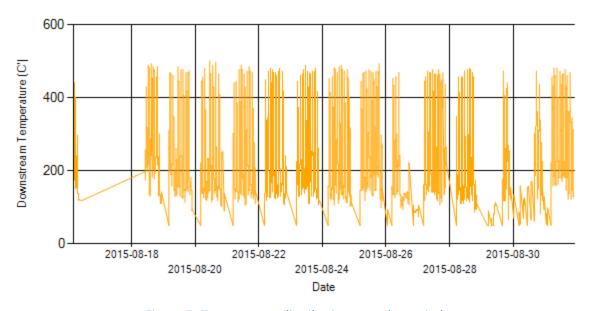


Figure 7- Temperature distribution over the period



Date: 20/Sep/2015

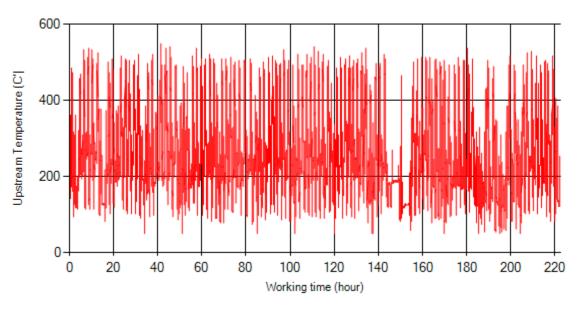


Figure 8- Temperature vs. working hours

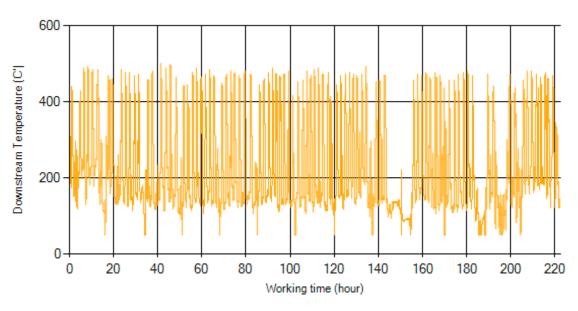


Figure 9- Temperature vs. working hours



Date: 20/Sep/2015

Engine Speed Diagrams

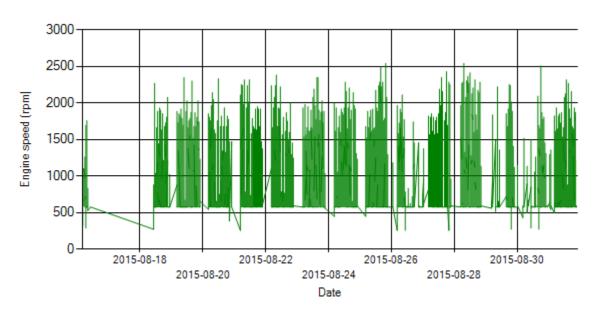


Figure 10- Engine speed distribution over the period

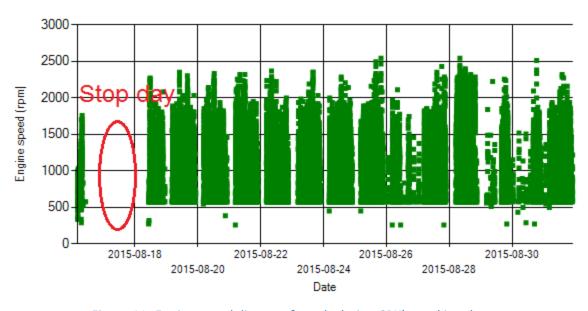


Figure 11- Engine speed diagram for calculating CPK's working days



Date: 20/Sep/2015

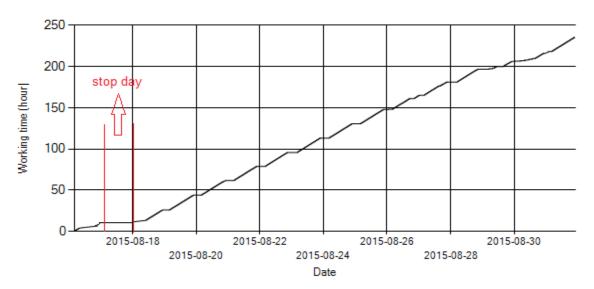


Figure 12- Time diagram for calculating CPK's working days

Notice: Data logger sampling time can be calculated from Figure 12. The lines parallel with Date axis show days without data logger data.

Pressure-Engine Speed diagrams

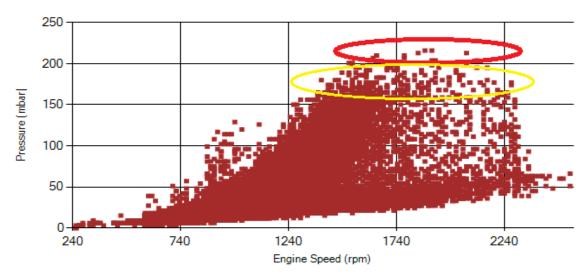


Figure 13- Pressure against engine speed

Notice: Red alarm (pressure>200 mbar) and yellow alarm (200>pressure>150) ranges were indicated in figure 13.



Date: 20/Sep/2015

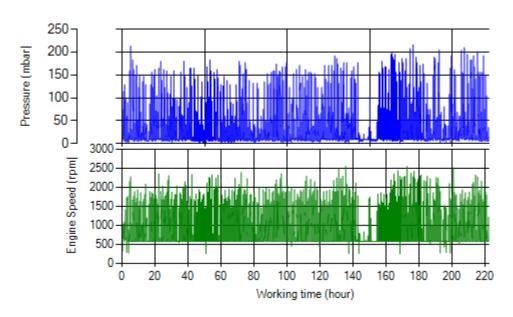


Figure 14- P, N distribution vs. working hours

Temperature-Engine Speed diagrams

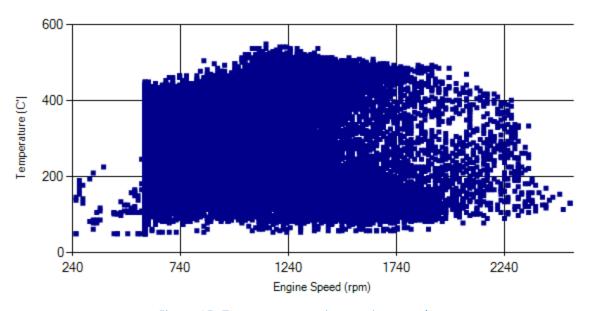


Figure 15- Temperature against engine speed



Date: 20/Sep/2015

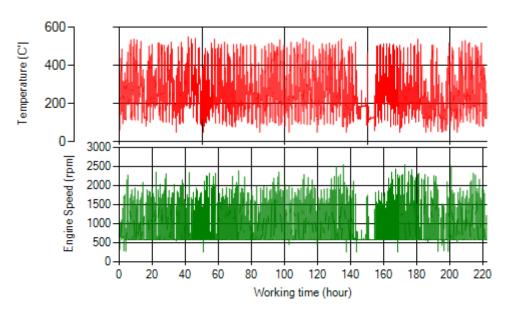


Figure 16- T, N distribution vs. working hours

Filter Operation Analysis

- As depicted in figure 1, 0.02% of total working time pressure is above 200 mbar and 0.71% above 150mbar.
- Figure 2 displays flow temperature distribution for DPF's upstream. It can be obviously observed that 13% of total working-time temperature is above 400 °C and 20% above 350°C.

Filter eneration status	Excellent ■	Good □
Filter operation status	Maintenance required □	Failed□