

Date: 22/Aug/2016

Overall Information

Table1- Overall Information

Table E Overall Information			
Vehicle plate number	85476		
CPK data logger number	LN: 001508, DN: 2003, Sim +989218469624		
Bus line	Number 10 (south to north Bus line)		
Bus Terminals	Azadi square - Daneshgah square		
Total path distance	10.7 km		
DPF producer company	HJS_04 (Passive system with FBC)		
Installation date	23/Feb/2015		
Report period	01/Aug/2016 – 15/Aug/2016 (fifteen days)		
K value - DPF upstream	1.85 [1/m]		
K value – DPF downstream	0.02 [1/m]		

Table 2- DPF Maintenance History

Filter maintenance date	DPF was cleaned on 22 nd Jul for the first time and on 15 th Dec for the second time after 44355 km mileage from installation date. Third cleaning was done on 8 th Aug 2016.
Dosing status	Dosing value has been kept constant from installation date until now.



Date: 22/Aug/2016

Table 3- Fuel and Additive Consumption Information

Table 3- Fuel and Additive Consumption Information			
Bus mileage (from DPF installation date)	72668 km		
Bus mileage over the period	828 km		
Working days over the period	8 days		
Stop days	7 days		
Data logger working days	8 days		
Working hours over the period	56 hours 46 minutes		
Average working hours per day (including stop days)	5 hours 9 minutes		
Bus average speed	14.6 km/hr		
idle speed time to all working time ration	46.51 %		
Total Bus fuel consumption over the period	439 lit		
Fuel consumption per hour	7.73 lit/hr		
Average fuel consumption	0.53 lit/km		
Total Bus additive consumption over the period	0.209 lit		
Average additive consumption	253.4 cc/km		
Additive consumption to fuel ration	478 cc/1000lit		



Date: 22/Aug/2016

Temperature, Pressure and Engine Speed Overview

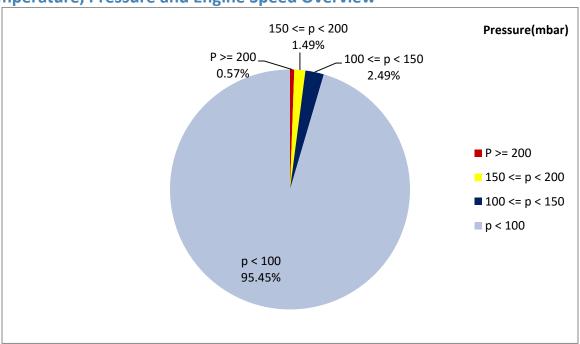


Figure 1- Pressure distribution over the working hours

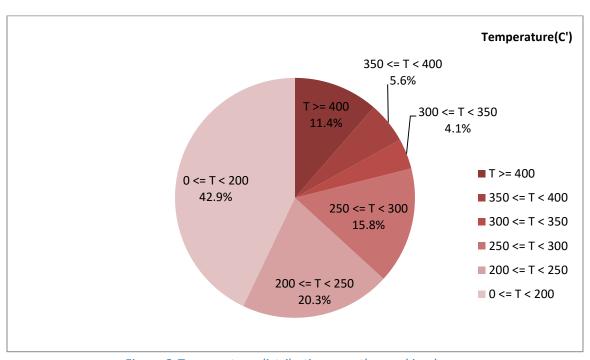


Figure 2-Temperature distribution over the working hours



Date: 22/Aug/2016

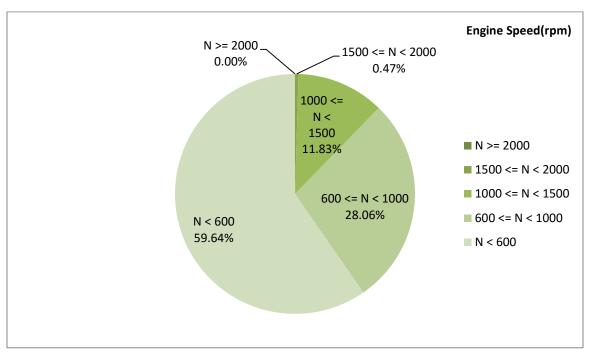


Figure 3- Engine speed distribution over the working hours

Table 4- Mean values

Mean temperature (C)	Mean pressure(mbar)	Mean engine speed(rpm)
243.4	23.55	658

Table 5- Mean values without idling

Mean temperature (C)	Mean pressure(mbar)	Mean engine speed(rpm)
267.47	34.74	777

Table 6- Max-min values

Max-min temperature(C)	Max-min pressure(mbar)	Max-min engine speed(rpm)
566-50	321-0	1968-256



Date: 22/Aug/2016

Detailed Pressure Analysis

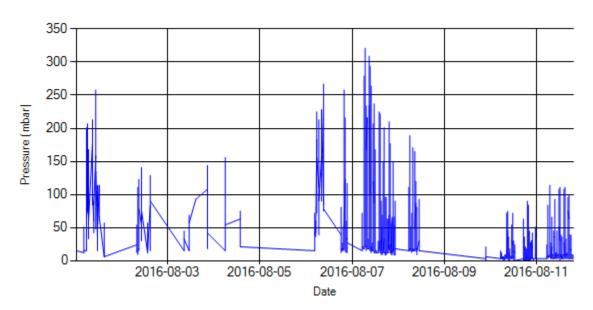


Figure 4- Pressure distribution over the period

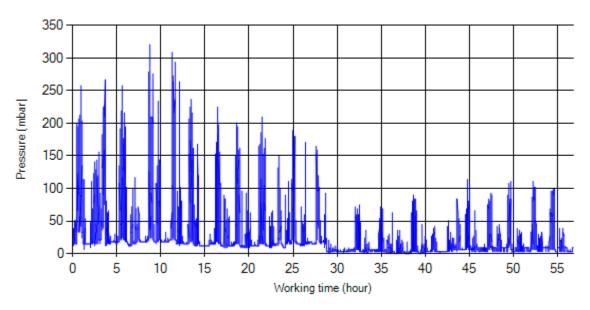


Figure 5- Pressure vs. working hours

Notice: backpressure distribution was shown into two diagrams. As obvious in figure 5, stopworking periods were eliminated and pressure was displayed along working hours.



Date: 22/Aug/2016

Detailed Temperature Analysis

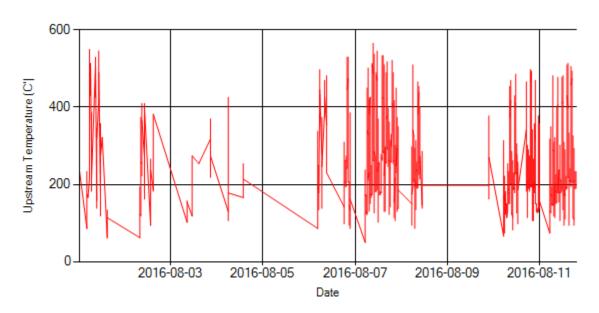


Figure 6- Temperature distribution over the period

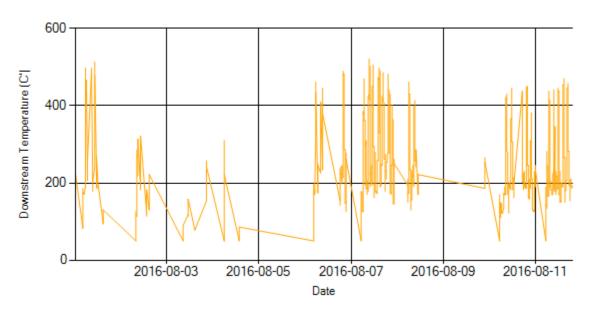


Figure 7- Temperature distribution over the period



Date: 22/Aug/2016

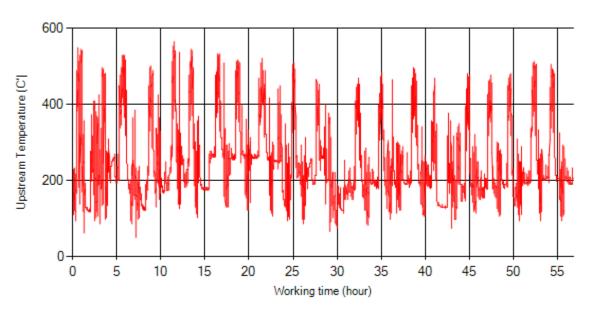


Figure 8- Temperature vs. working hours

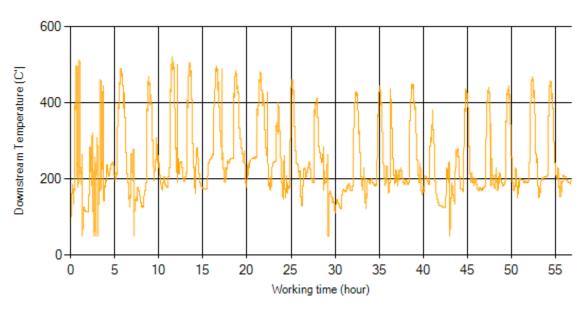


Figure 9- Temperature vs. working hours



Date: 22/Aug/2016

Engine Speed Diagrams

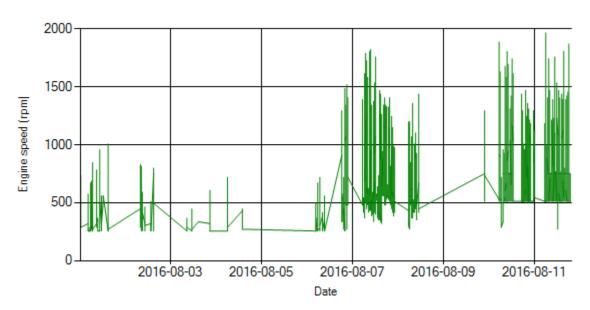


Figure 10- Engine speed distribution over the period

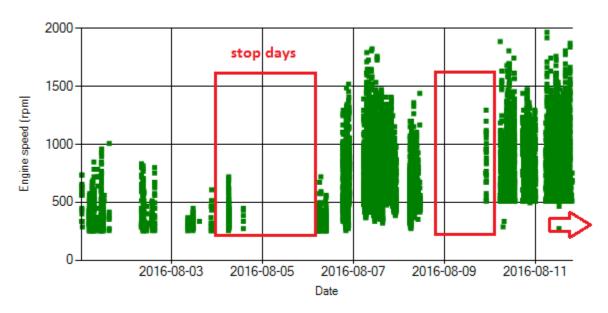


Figure 11- Engine speed diagram for calculating CPK's working days



Date: 22/Aug/2016

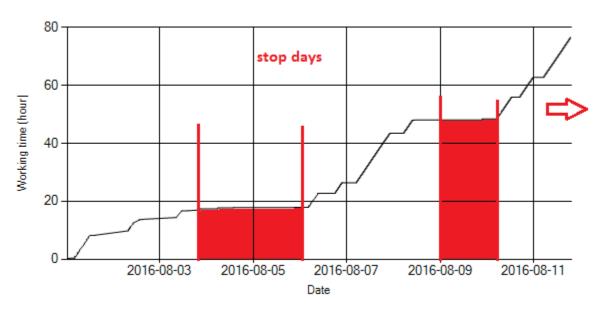


Figure 12- Time diagram for calculating CPK's working days

Notice: Data logger sampling time can be calculated from Figure 12. The lines parallel with Date axis show days without data logger data. As depicted in Figure 12 system was stationary for 7 days.

Pressure-Engine Speed diagrams

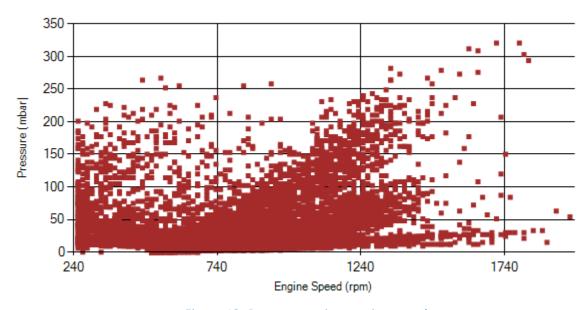


Figure 13- Pressure against engine speed



Date: 22/Aug/2016

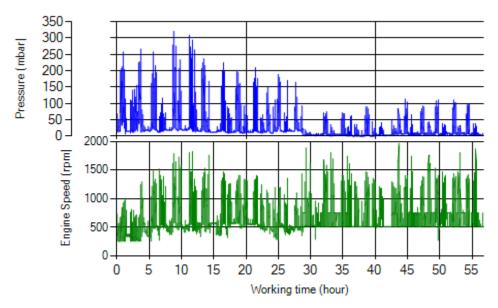


Figure 14- P, N distribution vs. working hours

Temperature-Engine Speed diagrams

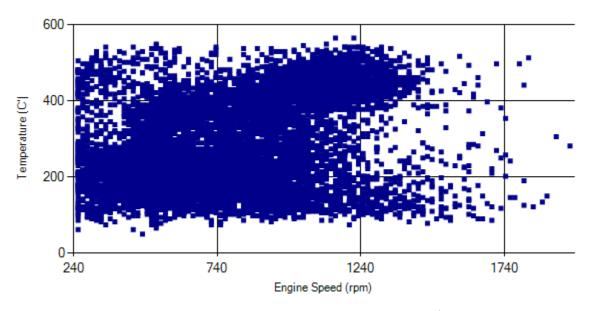


Figure 15- Temperature against engine speed



Date: 22/Aug/2016

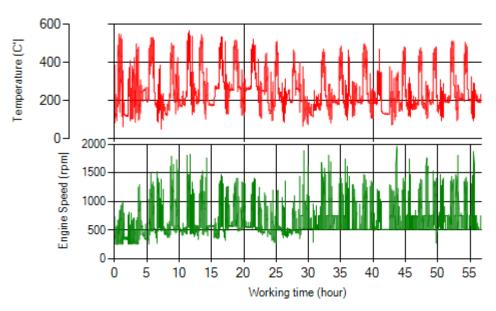


Figure 16- T, N distribution vs. working hours

Filter Operation Analysis

- As depicted in Figure 1, 0.57% of working time, pressure was above 200 mbar and 2.06% was above 150 mbar.
- Figure 2 displays flow temperature before the DPF. It can be obviously observed that 11.4% of total working time temperature is above 400 °C and 17% above 350°C.

Filter analystica status	Excellent	Good ■
Filter operation status	Maintenance required □	Failed □